

# Perfeccoat

## CAR PAINT

Product Technical Data Sheets

**YATU ADVANCED MATERIALS CO.,LTD.**  
SANLIAN INDUSTRIAL AREA 2, GULAO, HESHAN, GUANGDONG, P.R.C. 529700  
[www.yatupaint.com](http://www.yatupaint.com) E-mail: [info@yatupaint.com](mailto:info@yatupaint.com)



PERFECOAT PROFESSIONAL REFINISH SYSTEM



# CONTENTS


PC-2K Solid Colors.....	1
PC-1K Basecoat Colors.....	2
PC-60 Flip Controller.....	3
PC-10 Plastic Primer.....	3
PC-20 Epoxy Primer.....	4
PC-30 2K Primer Surfacer.....	5
GT-20 Speed Primer Plus.....	6
PC-6441 Fast 2K Primer Surfacer.....	7
PC-40 1K Primer Surfacer.....	8
PC-50 Filler.....	9
PC-6520 1K Binder.....	10
PC-6510 2K Binder.....	11
PC-400 Clear Coat.....	12
PC-400 Plus Clear Coat.....	13
PC-1000 Standard Clear Coat.....	14
PC-2000 HS Clear Coat.....	15
PC-6511 Extra Fast Clear Coat.....	16
PC-2800 Mirror Effect Clear Coat.....	17
PC-6800 Plus High Velocity Clear Coat.....	18
PC Series Hardener.....	19
PC Series Thinner.....	20
PC-6911 Degreaser.....	21
PC-6920 Thinner SRA.....	21
PC-6930 Anti-Silicon.....	22
PC-6940 Matting Agent.....	22
PC-6960 Retarder Solvent.....	23
PC-6980 Quick Drier.....	23

## Paint Defects

Orange Peel.....	25
Runs/Sags.....	25
Blushing.....	26
Fisheyes.....	26
Pinholes.....	27
Solvent Popping.....	27
Loss of Gloss.....	28
Lifting / Solvent Aggression.....	28
Poor Adhesion.....	29
Poor DIO.....	29
Cracking.....	30
Wrinkling.....	30
Particles and Dust.....	31
Poor Drying.....	31
Clouding or Mottling.....	32
Sanding Marks.....	32
Putty Marks or Edge Shrinking.....	33
Paint Mist, Dry Spray.....	33
Color Floating.....	34
Putty Patch or Substrate Scratches.....	34
Polyester Putty Adhesion Loss.....	35
Uneven Color, Color Variation.....	35
Off color, Color Mismatching.....	36
Yellowing of Clear Coat.....	36
Transparency, Poor Hiding.....	37
Bleeding.....	37
Chalking.....	38
Fading.....	38


## 1K Basecoat Colors Application Flow Chart

### 1、1K Basecoat Colors

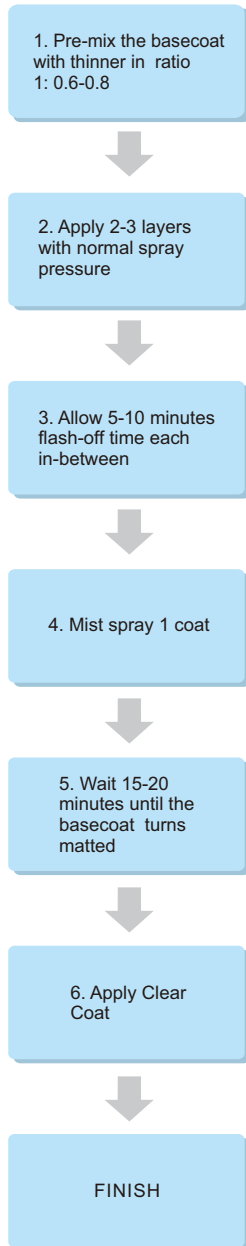

## 2K Solid Colors Application Flow Chart

### 2、2K Solid Colors

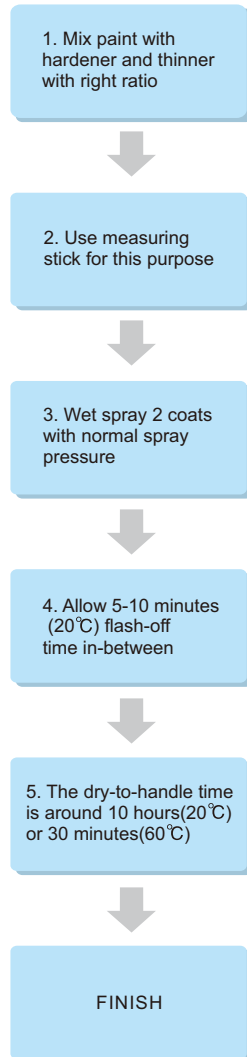

## Pictograph



Cleaning



Mixing ratio–  
2 components



Mixing Ratio–  
3 components



Ready for use



Use measuring rulers



Add hardener



Pot Life



Gravity feed spray gun



Suction feed  
spray gun



No.of coats



Flash–off time



Drying time



Dry sanding  
by machine



Wet sanding by hand



Dry sanding by hand



Polishing



Use spreader









Refer to product  
Instruction

## 2K Solid Colors

**Characteristic:** Medium and high class 2K topcoat solid colors, good hardness, high gloss and build, excellent protective and coverage power, long lasting bright color.

**Substrates:** Sanded and dried existing finishes, 1K or 2K primer.

	Surface Cleaning: Remove wax, silicon and other contaminations with degreaser					
	<div>Mixing Ratio</div> <div>&lt; 18℃ 18–24℃ 25–30℃ &gt;30℃</div>	<div>Solid Colors</div> <div>2</div> <div>2K Solid Colors</div>	+	<div>Hardener</div> <div>1</div> <div>PC-6611 PC-6612 PC-6612 PC-6613</div>	+	<div>Thinner</div> <div>0.2–0.5</div> <div>PC-1 PC-1/PC-2 PC-2/PC-3 PC-3</div>
	Pot-Life at 20℃: 2 hours with PC-6611 fast hardener 4 hours with PC-6612 standard or PC-6613 slow hardener					
	<div>Spray Gun Set Up</div>	<div>Gravity Feed: 1.2-1.4mm   Suction Feed: 1.3-1.5mm</div> <div>Conventional: 3-4 bar   RP: 2.0-2.5 bar   HVLP: 2.0 bar</div>				
	<div>Coats &amp; Thickness</div>	2-3 coats, total 40-60um				
	<div>Flash-Off Time</div>	At 20℃, 5-10 minutes between coats				
	<div>Air-Drying Time</div>	Allow 15-20 minutes air drying time before force drying				
	<div>Drying Time:</div>	<div>Temperature</div> <div>20℃ 60℃</div>	<div>Dust Free</div> <div>45 minutes 5 minutes</div>	<div>Tack Free</div> <div>2–3 hours 15 minutes</div>	<div>Dry to Handle</div> <div>10 hours 30 minutes</div>	<div>Dry to Polish</div> <div>16 hours 60 minutes</div>

Note:

- The substrate must be sanded and cleaned before spray. (Wet sanding: P600-P800, drying sanding: P400- P600)
- At temperature lower than 15°C, air-dry at ambient temperature is not recommended. Allow a full bake at 60°C.
- At ambient temperature higher than 30°C, add Retarder Solvent into thinner to avoid blushing. For details please refer to the technical data sheet of Retarder Solvent.
- In the event of fisheyes during application, add 0.5-1% Anti Silicon in the paint remained and re-spray the affected area.
- In the overspray area of new and existing finish, apply directly Thinner SRA to achieve an invisible transition. For details please refer to the TDS of Thinner SRA.
- The products mixed with hardener should be used up soon and can not restore for future use.
- Clean equipments immediately with solvent after application.
- If there are particles or runs after spray, sand the affected area with P1200-P2000 sand paper after thorough drying, then polish to solve the problem.







Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 1L or 3.75L

## 1K Basecoat Colors

**Characteristic:** Single component basecoat with solid colors, metallic and pearl effect, made from weathering resistant resins, high quality, strong coverage power, and excellent adhesion power.

**Substrates:** Sanded and dried existing finishes, 1K or 2K primer.

	Surface Cleaning: Remove wax, silicon and other contaminations with degreaser								
	Mixing Ratio	<table><tr><td>Basecoat Colors</td><td>+</td><td>Thinner</td></tr><tr><td>1</td><td></td><td>0.6-0.8</td></tr></table>	Basecoat Colors	+	Thinner	1		0.6-0.8	
Basecoat Colors	+	Thinner							
1		0.6-0.8							
	< 15°C	1K Basecoat Colors	PC-5						
	15–30°C		PC-1						
	>30°C		PC-2						
		<table><tr><td rowspan="2">Spray Gun Set Up</td><td>Gravity Feed: 1.2-1.4mm   Suction Feed: 1.3-1.5mm</td></tr><tr><td>Conventional: 3-4 bar   RP: 2.0-2.5 bar   HVLP: 2.0 bar</td></tr></table>		Spray Gun Set Up	Gravity Feed: 1.2-1.4mm   Suction Feed: 1.3-1.5mm	Conventional: 3-4 bar   RP: 2.0-2.5 bar   HVLP: 2.0 bar			
Spray Gun Set Up	Gravity Feed: 1.2-1.4mm   Suction Feed: 1.3-1.5mm								
	Conventional: 3-4 bar   RP: 2.0-2.5 bar   HVLP: 2.0 bar								
		<table><tr><td>Coats &amp; Thickness</td><td>2–3 coats, total 15–25um</td></tr><tr><td>Flash-Off Time</td><td>At 20°C, 5–10 minutes between coats</td></tr><tr><td>Air-Drying Time</td><td>Allow 10–15 minutes air drying time before force drying</td></tr></table>		Coats & Thickness	2–3 coats, total 15–25um	Flash-Off Time	At 20°C, 5–10 minutes between coats	Air-Drying Time	Allow 10–15 minutes air drying time before force drying
Coats & Thickness	2–3 coats, total 15–25um								
Flash-Off Time	At 20°C, 5–10 minutes between coats								
Air-Drying Time	Allow 10–15 minutes air drying time before force drying								

Note:


- The substrate must be sanded and cleaned before spray. (Wet sanding: P600-P800, drying sanding: P400- P600)
- At temperature over 30°C or in high humidity, it is recommended to use Retarder Solvent to avoid mottling.
- Because of the high transparency of metallic basecoat, good quality spray gun and professional spray techniques are required in order to prevent defects of mottling or poor metallic effects.
- To avoid problems of mottling or poor adhesion, the metallic paint film should not be thicker than 25um.
- Better effect could be achieved if the extra silver powder could be removed with tack rag after the flash-off of each coat.
- After spray, allow 10-15 minutes air-drying time, then spray clear coat at once. Over long air drying time would affect the adhesion power.

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 1L or 3.75L

## PC-60 Flip Controller

**Characteristic:** Effect additive for metallic colors.






	<p>Mixing Ratio: Volume</p> <p>20% or less of PC-60 can be used to lighten the side tone of the metallic color and create a darker face with appearance of larger metallic sparkle. Excess addition would affect the adhesion between basecoat and clear coat.</p>
---	--

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 1L

## PC-10 Plastic Primer

**Characteristic:** A single-component transparent fast drying primer, used to promote adhesion of paint system to plastic parts.

**Substrates:** Plastic parts such as PP, PA, PE.

	Surface cleaning: Sanding with P400-P600, remove wax, silicon or other contaminations with degreaser.								
		<table><tr><td rowspan="2">Spray Gun Set Up</td><td>Gravity Feed: 1.2–1.4mm    Suction Feed: 1.3–1.5mm</td></tr><tr><td>Conventional: 3–4 bar    RP: 2.0–2.5 bar    HVLP: 2.0 bar</td></tr></table>	Spray Gun Set Up	Gravity Feed: 1.2–1.4mm    Suction Feed: 1.3–1.5mm	Conventional: 3–4 bar    RP: 2.0–2.5 bar    HVLP: 2.0 bar				
Spray Gun Set Up	Gravity Feed: 1.2–1.4mm    Suction Feed: 1.3–1.5mm								
	Conventional: 3–4 bar    RP: 2.0–2.5 bar    HVLP: 2.0 bar								
		<table><tr><td>Coats &amp; Thickness</td><td>2-3 coats, total 1-2 um</td></tr><tr><td>Flash-Off Time</td><td>At 20°C, 5-10 minutes between coats</td></tr><tr><td>Air-Drying Time</td><td>Allow 15-20 minutes air drying time before force drying</td></tr></table>		Coats & Thickness	2-3 coats, total 1-2 um	Flash-Off Time	At 20°C, 5-10 minutes between coats	Air-Drying Time	Allow 15-20 minutes air drying time before force drying
Coats & Thickness	2-3 coats, total 1-2 um								
Flash-Off Time	At 20°C, 5-10 minutes between coats								
Air-Drying Time	Allow 15-20 minutes air drying time before force drying								

Note:









1. The product is ready to use.
2. It is recommended not to spray thickly to avoid peeling off.
3. Test is recommended before application due to the variety of plastic parts.
4. Spray primer over the plastic primer after flash off in 10-15 minutes.

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 1L

## PC-20 Epoxy Primer

**Characteristic:** Gives excellent rust proofing for bare metal, good adhesion power to steel, aluminum and galvanized steel.

**Substrates:** Sanded and dried existing finishes, steel, iron and glass fiber reinforced plastic.

	Surface cleaning: Remove wax, silicon and other contaminations with degreaser					
	Mixing Ratio	Epoxy Primer	+	Hardener	+	Thinner
	Weight	5		1		1-1.5
	Volume	3.5		1		1
	≥30°C	PC-20		PC-21		PC-22
	Pot-Life at 20°C: 4–6 hours with hardener					
	Spray Gun Set Up	Gravity Feed: 1.2–1.4mm   Suction Feed: 1.3–1.5mm Conventional: 3–4 bar   RP: 2.0–2.5 bar   HVLP: 2.0 bar				
	Coats & Thickness	2-3 coats, total 40-60 um				
	Flash-Off Time	At 20°C, 5-10 minutes between coats				
	Air-Drying Time	Allow 15-20 minutes air drying time before force drying				
	18-26 hours at 20°C or 40-60 minutes at 60°C					
	Dry sanding: P240–P400 Wet sanding: P600–P800					
	Re-coat with primer after flash-off time of 10-15 minutes.					









Note:

1. For oxidated iron and cast iron, shot blasted sa2.5 class with roughness of 30-75um, or acid wash the oxidated parts to get rid of rust.
  2. It is recommended to bake at 60-70°C for 30 minutes when temperature is below 10°C for better curing of paint film.
  3. Choose right hardener and thinner to avoid poor curing of paint film.
- Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 5KG

## PC-30 2K Primer Surfacer

**Characteristic:** Multi-purpose double pack primer surfacer, with strong filling power and fine adhesion between coats, has excellent flexibility and impact resistance which can increase gloss and build of topcoat.

**Substrates:** Sanded and dried existing finishes, all kinds of primer and putty.

	Surface Cleaning: Remove wax, silicon and other contaminations with degreaser																								
	<table><tr><td>Mixing Ratio (Weight)</td><td>2K Primer Surfacer</td><td>+</td><td>Hardener</td><td>+</td><td>Thinner</td></tr><tr><td>(Volume)</td><td>4</td><td></td><td>1</td><td></td><td>1-1.5</td></tr><tr><td>&lt; 25℃</td><td>PC-30</td><td></td><td>PC-31</td><td></td><td>PC-1</td></tr><tr><td>≥ 25℃</td><td>PC-30</td><td></td><td>PC-31</td><td></td><td>PC-2/PC-3</td></tr></table>	Mixing Ratio (Weight)	2K Primer Surfacer	+	Hardener	+	Thinner	(Volume)	4		1		1-1.5	< 25℃	PC-30		PC-31		PC-1	≥ 25℃	PC-30		PC-31		PC-2/PC-3
Mixing Ratio (Weight)	2K Primer Surfacer	+	Hardener	+	Thinner																				
(Volume)	4		1		1-1.5																				
< 25℃	PC-30		PC-31		PC-1																				
≥ 25℃	PC-30		PC-31		PC-2/PC-3																				
	Pot-Life at 20℃: 1.5 hours with PC-31 hardener																								
	<table><tr><td>Spray Gun</td><td>Gravity Feed: 1.2–1.4mm</td><td>Siphon Feed: 1.3–1.5mm</td></tr><tr><td>Spray Up</td><td>Conventional: 3–4 bar</td><td>RP: 2.0–2.5 bar HVLP: 2.0 bar</td></tr></table>	Spray Gun	Gravity Feed: 1.2–1.4mm	Siphon Feed: 1.3–1.5mm	Spray Up	Conventional: 3–4 bar	RP: 2.0–2.5 bar HVLP: 2.0 bar																		
Spray Gun	Gravity Feed: 1.2–1.4mm	Siphon Feed: 1.3–1.5mm																							
Spray Up	Conventional: 3–4 bar	RP: 2.0–2.5 bar HVLP: 2.0 bar																							
	<table><tr><td>Coats &amp; Thickness</td><td>2–3 coats, total 50–80um</td></tr><tr><td>Flash-Off Time</td><td>At 20℃, 5–10 minutes between coats</td></tr><tr><td>Air-Drying Time</td><td>Allow 15–20 minutes air drying time before force drying</td></tr></table>	Coats & Thickness	2–3 coats, total 50–80um	Flash-Off Time	At 20℃, 5–10 minutes between coats	Air-Drying Time	Allow 15–20 minutes air drying time before force drying																		
Coats & Thickness	2–3 coats, total 50–80um																								
Flash-Off Time	At 20℃, 5–10 minutes between coats																								
Air-Drying Time	Allow 15–20 minutes air drying time before force drying																								
	Drying Time: 4-6 hours at 20℃ or 45 minutes at 60℃																								
	Dry sanding: P240-P400 Wet sanding: P600-P800																								
	Re-coat: After drying and sanding, re-coat with all kinds of topcoat.																								

Note:

1. Clean equipments immediately after application

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 4kg

## PC-GT20 SpeedPrimer Plus

**Substrates:** Dried and sanded existing finishes, OEM panels, epoxy primer and putty.

**Product Description:** PC-GT20 SpeedPrimer Plus is a highly productive 2K primer surfacer designed for the high-production shop who demands premium quality and maximum throughput with reduced cycle time. It offers easy application and sanding with excellent gloss holdout for all topcoats.

PC-GT20 SpeedPrimer Plus can be sanded in 20 minutes by air drying or 5 minutes by force drying for spot or panel repair job. Matching with different hardener and thinner, the product can be converted to general sanding primer surfacer with fast air and force drying properties for repair job more than 2 panels, or wet-on-wet primer for new body parts.

### Product Features:

1. Dry-to-sand in 20 minutes at 25°C
2. Easy to apply, high performance of filling, sealing, flow and sandability
3. Excellent holdout for topcoat
4. Highly productive, improves shop throughput
5. Versatility: Suitable for rapid, standard, overall repairs, or wet-on-wet process for new parts

### Product Technical Data Sheet

Tack Free	Rapid	Standard	Overall	Non-sanding
The amount of applicable panel(s)	1-2	3-5	6 - full body	new panels
Matched Hardener	PC - GT201	PC - GT201	PC - 6641	PC - GT201
Matched Thinner	PC - GT202	PC - 1/ - 2/ - 3		
Mixing Ratio	Weight: 4:1:1.8-2 Volume: 3:1:1.8-2			(Primer surfacer+8% 2k solid color): Hardener: Thinner Weight: 4:1:2.5 Volume: 3:1:2.5:3
Pot Life(25°C)	20 minutes	40 minutes	1.5 hours	20 minutes
Applicable Viscosity	15 -18 seconds			13 - 15 seconds
Spray gun set up	Gravity RP Spray, Feed 1.6mm - 1.8mm			Feed 1.3mm - 1.5mm
	1.8 - 2.0 bar			1.8 - 2.0 bar
Coats	Wet spray 2-3 coats			
	Thickness of paint film: 40 - 50 um			25 – 35 um
Flash Time	1 minute or no flash	2 - 3 minutes	3 - 5 minutes	1 minute or no flash
Dry to sand	20 minutes (25°C)	40 minutes (25°C)	1.5 - 2 hours (25°C)	Apply topcoat until the paint film is matte. (25°C, 10 minutes)
	5 minutes (60°C)	10 minutes (60°C)	20 minutes (60°C)	













Note:

1. It is recommended to choose conventional thinner for rapid repair when temperature is over 35°C.
2. For rapid repair and spraying, mix moderate primer surfacer, spray it within 20 minutes, and then clean the spray gun immediately.
3. For the color tuning and non-sanding primer surfacer application process over new panels , the 2k solid color should be added less than 8%.

## PC-6441 Fast 2K Primer Surfacers

**Characteristic:** Multi-purpose double pack fast drying primer surfacer, with strong filling power, fine adhesion between coats and good sanding properties, can increase gloss and build of topcoat. The recommended application temperature is below 25°C.

**Substrates:** Sanded and dried existing finishes, all kinds of primer and putty.











	Surface Cleaning: Remove wax, silicon and other contaminations with degreaser																								
 	<table><tr><td>Mixing Ratio (Weight)</td><td>Fast 2K Primer Surfacers</td><td>+</td><td>Hardener</td><td>+</td><td>Thinner</td></tr><tr><td>(Volume)</td><td>4</td><td></td><td>1</td><td></td><td>1-1.5</td></tr><tr><td>≤ 25°C</td><td>3</td><td></td><td>1</td><td></td><td>1-1.5</td></tr><tr><td></td><td>PC-6441</td><td></td><td>PC-6641</td><td></td><td>PC-1</td></tr></table>	Mixing Ratio (Weight)	Fast 2K Primer Surfacers	+	Hardener	+	Thinner	(Volume)	4		1		1-1.5	≤ 25°C	3		1		1-1.5		PC-6441		PC-6641		PC-1
Mixing Ratio (Weight)	Fast 2K Primer Surfacers	+	Hardener	+	Thinner																				
(Volume)	4		1		1-1.5																				
≤ 25°C	3		1		1-1.5																				
	PC-6441		PC-6641		PC-1																				
	Pot-Life at 20°C: 30 minutes with hardener																								
 	<table><tr><td>Spray Gun Set Up</td><td>Gravity Feed: 1.2-1.4mm Suction Feed: 1.3-1.5mm</td></tr><tr><td></td><td>Conventional: 3-4 bar RP: 2.0-2.5 bar HVLP: 2.0 bar</td></tr></table>	Spray Gun Set Up	Gravity Feed: 1.2-1.4mm Suction Feed: 1.3-1.5mm		Conventional: 3-4 bar RP: 2.0-2.5 bar HVLP: 2.0 bar																				
Spray Gun Set Up	Gravity Feed: 1.2-1.4mm Suction Feed: 1.3-1.5mm																								
	Conventional: 3-4 bar RP: 2.0-2.5 bar HVLP: 2.0 bar																								
 	<table><tr><td>Coats &amp; Thickness</td><td>2-3 coats, total 40-60um</td></tr><tr><td>Flash-Off Time</td><td>At 20°C, 3-5 minutes between coats</td></tr><tr><td>Air-Drying Time</td><td>Allow 15-20 minutes air drying time before force drying</td></tr></table>	Coats & Thickness	2-3 coats, total 40-60um	Flash-Off Time	At 20°C, 3-5 minutes between coats	Air-Drying Time	Allow 15-20 minutes air drying time before force drying																		
Coats & Thickness	2-3 coats, total 40-60um																								
Flash-Off Time	At 20°C, 3-5 minutes between coats																								
Air-Drying Time	Allow 15-20 minutes air drying time before force drying																								
	Drying Time: 20°C, 2-3 hours 60°C, 45minutes																								
 	Dry sanding: P400-P600 Wet sanding: P800-P1000																								
	Re-coat: After drying and sanding, re-coat with all kinds of topcoat.																								

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 4kg

## PC-40 1K Primer Surfacers

**Characteristic:** Fast drying one pack primer surfacer, suitable to cover minor defects in surface of putty or existing finish. It is easy to apply with good filling power and ease of sanding for economical refinishing.

**Substrates:** Sanded and dried existing finishes and putty.

	Surface Cleaning: Remove wax, grease or other contaminations with degreaser				
 	<div>Mixing Ratio<div>1K Primer Surfacers</div><div>PC-40</div></div> <div>Weight/Volume<div>1</div></div> <div>Thinner<div>PC-1</div><div>0.8-1</div></div>				
 	<table><tr><td>Spray Gun</td><td>Gravity Feed: 1.2-1.4mm    Siphon Feed: 1.3-1.5mm</td></tr><tr><td>Spray Up</td><td>Conventional: 3-4 bar    RP: 2.0-2.5 bar    HVLP: 2.0 bar</td></tr></table>	Spray Gun	Gravity Feed: 1.2-1.4mm    Siphon Feed: 1.3-1.5mm	Spray Up	Conventional: 3-4 bar    RP: 2.0-2.5 bar    HVLP: 2.0 bar
Spray Gun	Gravity Feed: 1.2-1.4mm    Siphon Feed: 1.3-1.5mm				
Spray Up	Conventional: 3-4 bar    RP: 2.0-2.5 bar    HVLP: 2.0 bar				
 	<table><tr><td>Coats &amp; Thickness</td><td>2-3 coats, total 25-30um</td></tr><tr><td>Flash-Off Time</td><td>At 20°C, 5-10 minutes between coats</td></tr></table>	Coats & Thickness	2-3 coats, total 25-30um	Flash-Off Time	At 20°C, 5-10 minutes between coats
Coats & Thickness	2-3 coats, total 25-30um				
Flash-Off Time	At 20°C, 5-10 minutes between coats				
	Drying Time: 20°C, 30 minutes				
	Dry sanding: P600-P800 Wet sanding: P400-P600				
	Re-coat: After drying and sanding, re-coat with all kinds of topcoat.				

Note:





1. Not recommended for direct application over substrate of bare metal and wood.
2. Recommended to use 2K Primer to achieve good adhesion to substrate and excellent gloss and film build of the topcoat.
3. Not recommended to use thinner of fast drying type.

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 4kg

## PC-50 Filler

**Characteristic:** Single-component putty with good filling power, fast drying, easy to apply and sand, suitable to cover small scratches, sand holes and pinholes.

**Substrates:** Dried and sanded existing finishes, putty, 1K & 2K primer.

	Surface Cleaning: Remove wax, silicon, or other contaminations with degreaser
	Application Method: Directly spread thin coat by coat. Flash-off time of every coat is 10-15 minutes. Application Tool: Putty knife, soft rubber or plastic spreader.
	Drying time: 20°C, 30 minutes. Allow longer drying time for thick coating.
	Dry sanding: P400-P600 Wet sanding: P600-P800

**Note:**




1. Not recommended to apply over large area.
2. Not suitable for direct application over bare metals.
3. Spray topcoat directly after sanding if the application area is small. If large area, it is recommended to use 2K primer surfacer prior to topcoat.
4. Seal the can tightly after use to avoid skinning.

Shelf life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 1kg

## PC-6520 1K Binder

For PC-1K metallic basecoat, able to speed up air drying time, enhance the orientation of silver & pearl particles, and improve the application property.

	Match with: PC 1K Basecoat
Characteristic	Used in 3-stage or 2-stage colors to speed up air drying time, enhance the orientation of silver & pearl particles, and improve the application property.
  	<p>Mixing Ratio:</p> <ol style="list-style-type: none"> <li>1. Addition of PC-6520 to PC 1K metallic basecoat is 15-40% of total volume.</li> <li>2. For PC 1K silver white or other light color metallic basecoat, it is recommended to use no less than 25% PC-6520. When silver basecoat is used individually, add 40% PC-6520.</li> <li>3. In 3-stage pearl colors, add 50-70% PC-6520 into the pearl colors accordingly.</li> <li>4. For basecoat colors with low opacity, such as red pearl colors, addition of PC-6520 should be less than 15% so as not to affect the hiding power of the paint.</li> </ol>



Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 3.75L



## PC-6510 2K Binder

**Characteristic:** Resin solution used as an additive for spraying PC 2K solid colors. It improves the gloss of the paint film.

	Match with : PC 2K Solid Colors
	Mixing Ratio: PC 2K Solid Colors: PC-6510 2K Binder= 100:0-20 PC 2K Solid Colors+PC-6510 2K Binder : PC 2K series Hardener= 2:1

**Note:**







1. Do not add PC-6510 2K Binder if the coverage of the paint is poor.
2. Do not use in 1K basecoat or clear coat.

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 3.75L

## PC-400 Clear Coat

**Characteristic:** Double pack, it features smooth paint film and good gloss with durable resistance to weather and pollution.

**Substrates:** 1K basecoat

	Surface Cleaning: Clean the dust and particles with tack cloth					
	Mixing Ratio	Clear Coat	+	Hardener	+	Thinner
		2		1		0-0.1
	< 18℃	PC-400		PC-401		PC-1
	18-24℃	PC-400		PC-402		PC-1/PC-2
	25-30℃	PC-400		PC-402		PC-2/PC-3
	>30℃	PC-400		PC-403		PC-3
	Pot-Life at 20℃: 2 hours with PC-401 fast hardener 3 hours with PC-402 standard or PC-403 slow hardener					
	Spray Gun	Gravity Feed: 1.2-1.4mm Siphon Feed: 1.3-1.5mm				
	Spray Up	Conventional: 3-4 bar RP: 2.0-2.5 bar HVLP: 2.0 bar				
	Coats & Thickness	2-3 coats, total 40-60um				
	Flash-Off Time	At 20 ℃, 5-10 minutes between coats				
	Air-Drying Time	Allow 15-20 minutes air drying time before force drying				
	Drying Time:					
	Temperature	Dust Free	Tack Free	Dry to Handle	Dry to Polish	
	20℃	45 minutes	2-3 hours	10 hours	16 hours	
	60℃	5 minutes	15 minutes	30 minutes	60 minutes	









**Note:**

1. At temperature lower than 15°C, air-dry at ambient temperature is not recommended. Allow a full bake at 60°C.
2. At ambient temperature higher than 30°C, add Retarder Solvent into thinner to avoid blushing. Details please refer to the technical data sheet of Retarder Solvent.
3. In the event of fisheyes during application, add 0.5-1% Anti Silicon in the paint remained and re-spray the affected area.
4. In the overspray area of new and existing finish, apply directly Thinner SRA to achieve an invisible transition. Details please refer to the technical data sheet of Thinner SRA.
5. The products mixed with hardener should be used up soon and can not restore for future use.
6. Clean equipments immediately with solvent after application.
7. If there are particles or runs after spray, sand the affected area with P1200-P2000 sand paper after thorough drying, then polish to solve the problem.

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 1L/4L

## PC-400 Plus Clear Coat










**Characteristic:** Developed with hyper branch technology, great paint flowing, high gloss and build, easy application, suitable for spots repairs and rapid repairs of large areas under low temperature.

	Surface Cleaning: Clean the dust and particles with tack cloth																				
 	Mixing Ratio	<table><tr><td>Clear Coat</td><td>+</td><td>Hardener</td></tr><tr><td>2</td><td></td><td>1</td></tr></table>	Clear Coat	+	Hardener	2		1													
Clear Coat	+	Hardener																			
2		1																			
	< 18°C	PC-400	PC-401																		
	18-24°C	PC-400	PC-402																		
	25-30°C	PC-400	PC-402																		
	> 30°C	PC-400	PC-403																		
 	<table><tr><td>Spray Gun</td><td>Gravity Feed: 1.2-1.4mm</td><td>Siphon Feed: 1.3-1.5mm</td></tr><tr><td>Spray Up</td><td>Conventional: 3-4 bar</td><td>RP: 2.0-2.5 bar HVLP: 2.0 bar</td></tr></table>			Spray Gun	Gravity Feed: 1.2-1.4mm	Siphon Feed: 1.3-1.5mm	Spray Up	Conventional: 3-4 bar	RP: 2.0-2.5 bar HVLP: 2.0 bar												
Spray Gun	Gravity Feed: 1.2-1.4mm	Siphon Feed: 1.3-1.5mm																			
Spray Up	Conventional: 3-4 bar	RP: 2.0-2.5 bar HVLP: 2.0 bar																			
 	<table><tr><td>Coats &amp; Thickness</td><td colspan="2">Wet spray 2 coats, spray viscosity (20°C, Ford Cup DIN 4) 16-18 seconds, film thickness: 40-60um</td></tr><tr><td>Flash-Off Time</td><td colspan="2">At 20°C, 2-3 minutes between coats, 10-15 minutes before baking</td></tr></table>			Coats & Thickness	Wet spray 2 coats, spray viscosity (20°C, Ford Cup DIN 4) 16-18 seconds, film thickness: 40-60um		Flash-Off Time	At 20°C, 2-3 minutes between coats, 10-15 minutes before baking													
Coats & Thickness	Wet spray 2 coats, spray viscosity (20°C, Ford Cup DIN 4) 16-18 seconds, film thickness: 40-60um																				
Flash-Off Time	At 20°C, 2-3 minutes between coats, 10-15 minutes before baking																				
	<table><tr><td colspan="3">Drying Time:</td></tr><tr><td>Temperature</td><td>Dust Free</td><td>Dry to Polish</td></tr><tr><td>10°C</td><td>40 minutes</td><td>4 hours</td></tr><tr><td>15°C</td><td>30 minutes</td><td>8 hours</td></tr><tr><td>20°C</td><td></td><td>12 hours</td></tr><tr><td>60°C</td><td></td><td>20 hours</td></tr></table>			Drying Time:			Temperature	Dust Free	Dry to Polish	10°C	40 minutes	4 hours	15°C	30 minutes	8 hours	20°C		12 hours	60°C		20 hours
Drying Time:																					
Temperature	Dust Free	Dry to Polish																			
10°C	40 minutes	4 hours																			
15°C	30 minutes	8 hours																			
20°C		12 hours																			
60°C		20 hours																			

- Note:
- At temperature lower than 15°C, air-dry at ambient temperature is not recommended. Allow a full bake at 60°C.
  - Mix the clear coat according to the proportion indicated by manufacturer. The mixture should be used up within 2 hours.
- Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 1L/4L

## PC-1000 Standard Clear Coat

**Characteristic:** Medium solid clear coat, high gloss and good build, color and gloss protective power.  
**Substrates:** 1K basecoat










	Surface Cleaning: Clean the dust and particles with tack cloth																																			
 	Mixing Ratio	<table><tr><td>Clear Coat</td><td>+</td><td>Hardener</td><td>+</td><td>Thinner</td></tr><tr><td>2</td><td></td><td>1</td><td></td><td>0.2-0.3</td></tr><tr><td>&lt; 18°C</td><td></td><td>PC-1000</td><td></td><td>PC-1</td></tr><tr><td>18-24°C</td><td></td><td>PC-1000</td><td></td><td>PC-1/PC-2</td></tr><tr><td>25-30°C</td><td></td><td>PC-1000</td><td></td><td>PC-2/PC-3</td></tr><tr><td>&gt; 30°C</td><td></td><td>PC-1000</td><td></td><td>PC-3</td></tr></table>	Clear Coat	+	Hardener	+	Thinner	2		1		0.2-0.3	< 18°C		PC-1000		PC-1	18-24°C		PC-1000		PC-1/PC-2	25-30°C		PC-1000		PC-2/PC-3	> 30°C		PC-1000		PC-3				
Clear Coat	+	Hardener	+	Thinner																																
2		1		0.2-0.3																																
< 18°C		PC-1000		PC-1																																
18-24°C		PC-1000		PC-1/PC-2																																
25-30°C		PC-1000		PC-2/PC-3																																
> 30°C		PC-1000		PC-3																																
	Pot-Life at 25°C: 2 hours with PC-6611 fast hardener 3 hours with PC-6612 standard or PC-6613 slow hardener																																			
 	<table><tr><td>Spray Gun</td><td>Gravity Feed: 1.2-1.4mm    Suction Feed: 1.3-1.5mm</td></tr><tr><td>Set Up</td><td>Conventional: 3-4 bar    RP: 2.0-2.5 bar    HVLP: 2.0 bar</td></tr></table>	Spray Gun	Gravity Feed: 1.2-1.4mm    Suction Feed: 1.3-1.5mm	Set Up	Conventional: 3-4 bar    RP: 2.0-2.5 bar    HVLP: 2.0 bar																															
Spray Gun	Gravity Feed: 1.2-1.4mm    Suction Feed: 1.3-1.5mm																																			
Set Up	Conventional: 3-4 bar    RP: 2.0-2.5 bar    HVLP: 2.0 bar																																			
 	<table><tr><td>Coats &amp; Thickness</td><td colspan="4">2-3 coats, total 40-60 um</td></tr><tr><td>Flash-Off Time</td><td colspan="4">At 20°C, 5-10 minutes between coats</td></tr><tr><td>Air-Drying Time</td><td colspan="4">Allow 15-20 minutes air drying time before force drying</td></tr></table>	Coats & Thickness	2-3 coats, total 40-60 um				Flash-Off Time	At 20°C, 5-10 minutes between coats				Air-Drying Time	Allow 15-20 minutes air drying time before force drying																							
Coats & Thickness	2-3 coats, total 40-60 um																																			
Flash-Off Time	At 20°C, 5-10 minutes between coats																																			
Air-Drying Time	Allow 15-20 minutes air drying time before force drying																																			
	Drying Time:																																			
	<table><tr><td>Temperature</td><td>Dust Free</td><td>Tack Free</td><td>Dry to Handle</td><td>Dry to Polish</td></tr><tr><td>20°C</td><td>45 minutes</td><td>2-3 hours</td><td>10 hours</td><td>16 hours</td></tr><tr><td>60°C</td><td>5 minutes</td><td>15 minutes</td><td>30 minutes</td><td>60 minutes</td></tr></table>	Temperature	Dust Free	Tack Free	Dry to Handle	Dry to Polish	20°C	45 minutes	2-3 hours	10 hours	16 hours	60°C	5 minutes	15 minutes	30 minutes	60 minutes																				
Temperature	Dust Free	Tack Free	Dry to Handle	Dry to Polish																																
20°C	45 minutes	2-3 hours	10 hours	16 hours																																
60°C	5 minutes	15 minutes	30 minutes	60 minutes																																

- Note:
- At temperature lower than 15°C, air-dry at ambient temperature is not recommended. Allow a full bake at 60°C.
  - At ambient temperature higher than 30°C, add Retarder Solvent into thinner to avoid blushing. For details please refer to the TDS of Retarder Solvent.
  - In the event of fisheyes during application, add 0.5-1% Anti Silicon in the paint remained and re-spray the affected area.
  - In the overspray area of new and existing finish, apply directly Thinner SRA to achieve an invisible transition. For details please refer to the TDS of Thinner SRA.
  - The products mixed with hardener should be used up soon and can not restore for future use.
  - Clean equipments immediately with solvent after application.
  - If there are particles or runs after spray, sand the affected area with P1200-P2000 sand paper after thorough drying, then polish to solve the problem.
- Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 1L/4L

## PC-2000 HS Clear Coat

**Characteristic:** High performance double component clear coat, high gloss, good build, strong chemical resistant, excellent color and gloss protective power, suitable for overall refinishing and spot repair.

**Substrates:** 1K basecoat

	Surface Cleaning: Clean the dust and particles with tack cloth																																				
 	<table><tr><td>Mixing Ratio</td><td>Clear Coat</td><td>+</td><td>Hardener</td><td>+</td><td>Thinner</td></tr><tr><td></td><td>2</td><td></td><td>1</td><td></td><td>0.2–0.5</td></tr><tr><td>&lt; 18°C</td><td>PC-2000</td><td></td><td>PC-6621</td><td></td><td>PC-1</td></tr><tr><td>18–24°C</td><td>PC-2000</td><td></td><td>PC-6622</td><td></td><td>PC-1/PC-2</td></tr><tr><td>25–30°C</td><td>PC-2000</td><td></td><td>PC-6622</td><td></td><td>PC-2/PC-3</td></tr><tr><td>&gt; 30°C</td><td>PC-2000</td><td></td><td>PC-6623</td><td></td><td>PC-3</td></tr></table>	Mixing Ratio	Clear Coat	+	Hardener	+	Thinner		2		1		0.2–0.5	< 18°C	PC-2000		PC-6621		PC-1	18–24°C	PC-2000		PC-6622		PC-1/PC-2	25–30°C	PC-2000		PC-6622		PC-2/PC-3	> 30°C	PC-2000		PC-6623		PC-3
Mixing Ratio	Clear Coat	+	Hardener	+	Thinner																																
	2		1		0.2–0.5																																
< 18°C	PC-2000		PC-6621		PC-1																																
18–24°C	PC-2000		PC-6622		PC-1/PC-2																																
25–30°C	PC-2000		PC-6622		PC-2/PC-3																																
> 30°C	PC-2000		PC-6623		PC-3																																
	Pot-Life at 25°C: 2 hours with PC-6621 fast hardener 3 hours with PC-6622 standard or PC-6623 slow hardener																																				
 	<table><tr><td>Spray Gun</td><td>Gravity Feed: 1.2-1.4mm Suction Feed: 1.3-1.5mm</td></tr><tr><td>Set Up</td><td>Conventional: 3-4 bar RP: 2.0-2.5 bar HVLP: 2.0 bar</td></tr></table>	Spray Gun	Gravity Feed: 1.2-1.4mm Suction Feed: 1.3-1.5mm	Set Up	Conventional: 3-4 bar RP: 2.0-2.5 bar HVLP: 2.0 bar																																
Spray Gun	Gravity Feed: 1.2-1.4mm Suction Feed: 1.3-1.5mm																																				
Set Up	Conventional: 3-4 bar RP: 2.0-2.5 bar HVLP: 2.0 bar																																				
 	<table><tr><td>Coats &amp; Thickness</td><td>2-3 coats, total 50-70 um</td></tr><tr><td>Flash-Off Time</td><td>At 20°C, 5-10 minutes between coats</td></tr><tr><td>Air-Drying Time</td><td>Allow 15-20 minutes air drying time before force drying</td></tr></table>	Coats & Thickness	2-3 coats, total 50-70 um	Flash-Off Time	At 20°C, 5-10 minutes between coats	Air-Drying Time	Allow 15-20 minutes air drying time before force drying																														
Coats & Thickness	2-3 coats, total 50-70 um																																				
Flash-Off Time	At 20°C, 5-10 minutes between coats																																				
Air-Drying Time	Allow 15-20 minutes air drying time before force drying																																				
	<table><tr><td colspan="5">Drying Time:</td></tr><tr><td>Temperature</td><td>Dust Free</td><td>Tack Free</td><td>Dry to Handle</td><td>Dry to Polish</td></tr><tr><td>20°C</td><td>45 minutes</td><td>2–3 hours</td><td>10 hours</td><td>16 hours</td></tr><tr><td>60°C</td><td>5 minutes</td><td>15 minutes</td><td>30 minutes</td><td>60 minutes</td></tr></table>	Drying Time:					Temperature	Dust Free	Tack Free	Dry to Handle	Dry to Polish	20°C	45 minutes	2–3 hours	10 hours	16 hours	60°C	5 minutes	15 minutes	30 minutes	60 minutes																
Drying Time:																																					
Temperature	Dust Free	Tack Free	Dry to Handle	Dry to Polish																																	
20°C	45 minutes	2–3 hours	10 hours	16 hours																																	
60°C	5 minutes	15 minutes	30 minutes	60 minutes																																	








Note:

- At temperature lower than 15°C, air-dry at ambient temperature is not recommended. Allow a full bake at 60°C.
- At ambient temperature higher than 30°C, add Retarder Solvent into thinner to avoid blushing. For details please refer to the TDS of Retarder Solvent.
- In the event of fisheyes during application, add 0.5-1% Anti Silicon in the paint remained and re-spray the affected area.
- In the overspray area of new and existing finish, apply directly Thinner SRA to achieve an invisible transition. For details please refer to the TDS of Thinner SRA.
- The products mixed with hardener should be used up soon and can not restore for future use.
- Clean equipments immediately with solvent after application.
- If there are particles or runs after spray, sand the affected area with P1200-P2000 sand paper after thorough drying, then polish to solve the problem.  
Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 1L/4L

## PC-6511 Extra Fast Clear Coat

**Characteristic:** Double pack acrylic extra fast drying clear coat, easy application, good gloss, suitable for metal, solid basecoat and spot repair.

**Substrates:** 1K basecoat

	Surface Cleaning: Clean the dust and particles with tack cloth																								
	<table><tr><td>Mixing Ratio</td><td>Primer Surfacer</td><td>+</td><td>Hardener</td></tr><tr><td></td><td>2</td><td></td><td>1</td></tr><tr><td>&lt;18°C</td><td>PC-6511</td><td></td><td>PC-401</td></tr><tr><td>18-30°C</td><td>PC-6511</td><td></td><td>PC-402</td></tr><tr><td>&gt; 30°C</td><td>PC-6511</td><td></td><td>PC-403</td></tr></table>	Mixing Ratio	Primer Surfacer	+	Hardener		2		1	<18°C	PC-6511		PC-401	18-30°C	PC-6511		PC-402	> 30°C	PC-6511		PC-403				
Mixing Ratio	Primer Surfacer	+	Hardener																						
	2		1																						
<18°C	PC-6511		PC-401																						
18-30°C	PC-6511		PC-402																						
> 30°C	PC-6511		PC-403																						
	Pot-Life at 25°C: The mixture should be used up within 1 hour																								
	<table><tr><td>Spray Gun</td><td>Gravity Feed: 1.2-1.4mm Suction Feed: 1.3-1.5mm</td></tr><tr><td>Set Up</td><td>Conventional: 3-4 bar RP: 2.0-2.5 bar HVLP: 2.0 bar</td></tr></table>	Spray Gun	Gravity Feed: 1.2-1.4mm Suction Feed: 1.3-1.5mm	Set Up	Conventional: 3-4 bar RP: 2.0-2.5 bar HVLP: 2.0 bar																				
Spray Gun	Gravity Feed: 1.2-1.4mm Suction Feed: 1.3-1.5mm																								
Set Up	Conventional: 3-4 bar RP: 2.0-2.5 bar HVLP: 2.0 bar																								
	<table><tr><td>Coats &amp; Thickness</td><td>2-3 coats, total 50-70um</td></tr><tr><td>Flash-Off Time</td><td>At 20°C, 5-10 minutes between coats</td></tr><tr><td>Air-Drying Time</td><td>Allow 15-20 minutes air drying time before force drying</td></tr></table>	Coats & Thickness	2-3 coats, total 50-70um	Flash-Off Time	At 20°C, 5-10 minutes between coats	Air-Drying Time	Allow 15-20 minutes air drying time before force drying																		
Coats & Thickness	2-3 coats, total 50-70um																								
Flash-Off Time	At 20°C, 5-10 minutes between coats																								
Air-Drying Time	Allow 15-20 minutes air drying time before force drying																								
	<table><tr><td colspan="4">Drying Time:</td></tr><tr><td>Temperature</td><td>Dust Free</td><td>Dry to Handle</td><td>Dry to Polish</td></tr><tr><td>20°C</td><td>30-40 minutes</td><td>120 minutes</td><td>6 days</td></tr><tr><td>15°C</td><td>20-30minutes</td><td>60 minutes</td><td>6 days</td></tr><tr><td>25°C</td><td>15-20minutes</td><td>40 minutes</td><td>6 days</td></tr><tr><td>60°C</td><td>5 minutes</td><td>10 minutes</td><td>80 minutes</td></tr></table>	Drying Time:				Temperature	Dust Free	Dry to Handle	Dry to Polish	20°C	30-40 minutes	120 minutes	6 days	15°C	20-30minutes	60 minutes	6 days	25°C	15-20minutes	40 minutes	6 days	60°C	5 minutes	10 minutes	80 minutes
Drying Time:																									
Temperature	Dust Free	Dry to Handle	Dry to Polish																						
20°C	30-40 minutes	120 minutes	6 days																						
15°C	20-30minutes	60 minutes	6 days																						
25°C	15-20minutes	40 minutes	6 days																						
60°C	5 minutes	10 minutes	80 minutes																						
	Re-coat: Sand the affected area with P-2000 sandpaper where there are particles or runs after thorough drying, then polish to solve the problem.																								

Note:

- When temperature lower than 5°C in winter, allow a full bake at 60°C to speed up drying.
- At ambient temperature higher than 30°C, add Retarder Solvent into thinner to avoid blushing. For details please refer to the TDS of Retarder Solvent.
- In the event of fisheyes during application, add 0.5-1% Anti Silicon in the paint remained and re-spray the affected area.
- In the overspray area of new and existing finish, apply directly Thinner SRA to achieve an invisible transition. For details please refer to the TDS of Thinner SRA.
- The products mixed with hardener should be used up soon and can not restore for future use.
- Clean equipments immediately with solvent after application.










Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 1L/4L

## PC-2800 Mirror Effect Clear Coat

**Characteristics:** Medium-high solid two-pack fast drying clear coat with mirror effect and deep rich gloss, suitable for overall refinish and spot repair while offering durability, yellowing resistance and excellent chemical resistance.

**Substrates:** 1K Basecoat

	Surface Cleaning: Clean the dust and particles with tack cloth					
 	Mixing Ratio	Clear Coat	+	Hardener	+	Thinner
		2		1		0.2-0.4
	< 18°C	PC-2800		PC-6671		PC-1
	18-24°C	PC-2800		PC-6672		PC-1/PC-2
	25-30°C	PC-2800		PC-6672		PC-2/PC-3
	>30°C	PC-2800		PC-6673		PC-3
	Pot-Life at 20°C: 2 hours with PC 6671 fast hardener 4 hours with PC 6672 standard or PC 6673 slow hardener					
 	Spray Gun Set Up	Gravity Feed: 1.2-1.4mm   Suction Feed: 1.3-1.5mm Conventional: 3-4 bar   RP: 2.0-2.5 bar   HVLP: 2.0 bar				
 	Coats & Thickness	2-3 coats, total 40-60um				
	Flash-Off Time	At 20°C, 5-10 minutes between coats				
	Air-Drying Time	Allow 15-20 minutes air drying time before force drying				
	Drying Time:					
	Temperature	Dust Free	Tack Free	Dry to Handle	Dry to Polish	
	20°C	45 minutes	2-3 hours	10 hours	16 hours	
	60°C	5 minutes	15 minutes	30 minutes	60 minutes	








Note:

- When temperature lower than 5°C in winter, allow a full bake at 60°C to speed up drying.
  - At ambient temperature higher than 30°C, add Retarder Solvent into thinner to avoid blushing. For details please refer to the TDS of Retarder Solvent.
  - In the event of fisheyes during application, add 0.5-1% Anti Silicon in the paint remained and re-spray the affected area.
  - In the overspray area of new and existing finish, apply directly Thinner SRA to achieve an invisible transition. For details please refer to the TDS of Thinner SRA.
  - The products mixed with hardener should be used up soon and can not restore for future use.
  - Clean equipments immediately with solvent after application.
- Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 1L/4L

## PC-6800 Plus High Velocity Clear Coat

**Characteristic:** Double pack acrylic extra fast drying clear coat, easy application, good gloss, suitable for metal, solid basecoat and spot repair.

**Substrates:** 1K basecoat

	Surface Cleaning: Clean the dust and particles with tack cloth			
	Mixing Ratio	Clear Coat	+	Hardener
		2		1
	<18°C	PC-6800		PC-6671
	18-30°C	PC-6800		PC-6672
	> 30°C	PC-6800		PC-6673
	Pot-Life at 25°C: Within one hour			
	Spray Gun Set Up	Gravity Feed: 1.2-1.4mm   Suction Feed: 1.3-1.5mm Conventional: 3-4 bar   RP: 2.0-2.5 bar   HVLP: 2.0 bar		
	Coats & Thickness	2 coats, 40 um		
	Flash-Off Time	No flash-off time		
	Drying Time:			
	Temperature	Dust Free	Dry to Polish	
	10°C	30-40 minutes	120 minutes	
	15°C	20-30minutes	60 minutes	
	25°C	15-20minutes	40 minutes	
	Re-coat: If there are particles or runs after spray, sand the affected area with P2000 sand paper after thorough drying, then polish to solve the problem.			

Note:

- At temperature lower than 15°C, air-dry at ambient temperature is not recommended. Allow a full bake at 60°C.
  - At ambient temperature higher than 30°C, add Retarder Solvent into thinner to avoid blushing. For details please refer to the TDS of Retarder Solvent.
  - In the event of fisheyes during application, add 0.5-1% Anti Silicon in the paint remained and re-spray the affected area.
  - In the overspray area of new and existing finish, apply directly Thinner SRA to achieve an invisible transition. For details please refer to the TDS of Thinner SRA.
  - The products mixed with hardener should be used up soon and can not restore for future use.
  - Clean equipments immediately with solvent after application.
  - If there are particles or runs after spray, sand the affected area with P1200-P2000 sand paper after thorough drying, then polish to solve the problem.
- Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 1L/4L

## PC 2K Series Hardener

AA series of yellow resistant hardener, specially designed for 2k solid colors and clear coats. To match different products, application area and conditions, it includes various versions as standard, fast, slow drying and high solid hardener and so on.



Match with: 2K Solid Colors  
PC-1000 Standard Clear Coat  
PC-2000 HS Clear Coat  
PC-6800 Plus High Velocity Clear Coat

### Characteristic

PC-6611 Fast Hardener	Medium solid fast drying hardener for 2K solid colors and PC-1000, suitable for spot repair and low temperature application below<18°C.
PC-6612 Fast Hardener	Medium solid standard drying hardener for 2K solid colors and PC-1000, suitable for spot repair and overall refinishing at 18-30°C.
PC-6613 Fast Hardener	Medium solid standard drying hardener for 2K solid colors and PC-1000, suitable for spot repair and overall refinishing above 30°C.
PC-6621 Fast Hardener	High solid fast drying hardener for PC-2000, suitable for spot repair and low temperature application below<18°C.
PC-6622 Fast Hardener	High solid standard drying hardener for PC-2000, suitable for spot repair and overall refinishing at 18-30°C.
PC-6623 Fast Hardener	High solid slow drying hardener for PC-2000, suitable for spot repair and overall refinishing above 30°C.
PC-6671 Fast Hardener	High velocity fast drying hardener for PC-2800 and PC-6800, suitable for spot repair and low temperature application below <18°C.
PC-6672 Fast Hardener	High velocity standard drying hardener for PC-2800 and PC-6800, suitable for spot repair and overall refinishing at 18-30°C.
PC-6673 Fast Hardener	High velocity slow drying hardener for PC-2800 and PC-6800, suitable for spot repair and overall refinishing above 30°C.

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 0.5L /1L / 4L

## PC Series Thinner

High quality thinner, specially developed for PC primer, basecoat and topcoat. Available with fast, standard, slow and extra slow drying speed to match different products and different application requirements.



Usage: To reduce the application viscosity, increase the smoothness of paint film. Good solubility.

### Characteristic

PC-5 Fast	1K basecoat only, with very fast evaporation speed, suitable for spot repair or application below 15°C.
PC-1 Standard	Standard thinner for 1K basecoat and 2K products, with medium evaporation speed, suitable for spot repair or application at 15-25°C.
PC-2 Slow	For 1K basecoat and 2K products, with slow evaporation speed, suitable for spot repair or overall refinishing or application at 25-30°C.
PC-3 Extra Slow	2K products only, with every slow evaporation speed, suitable for overall refinishing, large area application or application over 30°C.

### Note:



- If the temperature and humidity are too high, 10–30% PC-6960 Retarder Solvent can be added.

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C  
Packaging: 1L/4L

## PC-6911 Degreaser

**Characteristic:** Able to remove grease, oil and other surface contaminants to avoid paint film defects.

**Substrates:** Existing finishes, primer, putty and metal.

	Mixing Ratio: Ready for use.
	Usage: 1. Clean the substrate with water to remove water-soluble contaminants and then dry it off. 2. Degrease the substrate with tack rag wetted with degreaser. 3. Wipe and dry the surface with another clean tack rag.

Note:

1. Use Degreaser before sanding to avoid oil contamination going into the sanding mark.
2. Degreaser and clean the surface again with Degreaser after sanding.



Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 1L/4L

## PC-6920 Thinner SRA

**Characteristic:** To dissolve the rough overspray area of new and existing finishes and achieve an invisible transition for panel repair.

**Field of application:** Overspray area of 2K solid colors, clear coat in panel repairs.

	Mixing Ratio: The product is ready to use.  Can mix with the paint remained in the spray gun in the ratio of 1:1
	Application Method: Spray lightly one coat over the overspray area with Thinner SRA right after the finish. Second coat in 20 seconds.

Note:

1. Not suitable with 1K basecoat and primer.



Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 1L

## PC-6930 Anti-Silicon

**Characteristic:** Additive for 2K solid colors or clear coats, able to remove fisheyes or craterings on the paint film.

**Match with:** 2K solid colors or clear coat

	Mixing Ratio: Paint ready for use: Anti silicon = 1L : 0.5-2 tin cap (about 4-15g)
	Application Method: Spray one or two coats over the paint film with fisheyes or craterings by paint mixed with anti silicon.

Note:

1. Mix with right ratio of anti silicon. Excess addition may cause defect of small bubbles or pinholes.
2. In serious problems, fisheyes affected paint film must be sanded out and filled when it is hard dry. Refinish with paint mixed with anti silicon.



Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 1L

## PC-6940 Matting Agent

**Characteristic:** Used to reduce the brightness of the paint film. Good matting ability with smooth paint film. Suitable for 1K and 2K system.

**Match with:** 2K solid colors, clear coats and 1K basecoat

	Mixing Ratio: 1K Basecoat : PC-6940 = (85-70) : (15-30) 2K topcoat:			
	Effect	2K topcoat	PC-6940	Hardener
	All matte	30 parts	70 parts	15 parts
	Half matte(egg shell)	50 parts	50 parts	25 parts
	Half bright	70 parts	30 parts	35 parts
	Application Method: Refer to the technical data sheet of the matching products for proper application.			

Note:

1. The matting agent is easy to crystallize when exposed to air too long. To avoid particles in the paint film, especially when applied in combination with clear coat, remove crystallized particles and other contaminations around the can rim before use and pour out with filter.



Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 1L

## PC-6960 Retarder Solvent

**Characteristic:** Additive to prolong volatilization of solvent. Helps to produce a quality refinishing job of good leveling and blushing-free at circumstances of high temperature, humidity or large area repair.

**Match With:** 1K basecoat, 2K solid colors and clear coats


	<p>Mixing Ratio: Add 10-30% retarder solvent into PC-2 or PC-3 thinner when the ambient temperature is over 30°C.</p>
	<p>Application Method: Refer to the technical data sheet of the matching products for proper application.</p>

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 1L

## PC-6980 Quick Drier

**Characteristic:** Specially designed for 2K solid colors and clear coat, can speed up the dust free time and air drying time of paint film, suitable for spot repair or application at low temperature.

	<p>Mixing Ratio:</p> <ol style="list-style-type: none"> <li>1. 10-15°C: 5-6g PC-6980 Quick Drier into 1L ready-to-spray paint;</li> <li>2. 0-10°C: 6-10g PC-6980 Quick Drier into 1L ready-to-spray paint;</li> <li>3. Below 0°C: 10-15g PC-6980 Quick Drier into 1L ready-to-spray paint.</li> </ol>
---	---

Note:

1. Pot life of paint mixed with PC-6980 Quick Drier would be shortened considerably, use up as soon as possible;
2. Recommended addition of PC-6980 Quick Drier is not over than 15g for 1L ready-to-spray paint, otherwise it would cause paint film embrittlement and loss of gloss.
3. PC-6980 Quick Drier can not be used as hardener.

Shelf Life: 2 years in original sealed can at cool and dry place at 20°C

Packaging: 1L


# Perfeccoat

## CAR PAINT





## Orange Peel

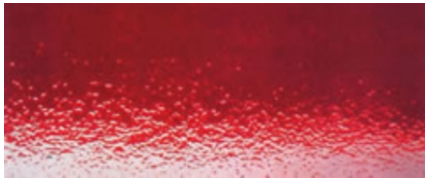

### (Poor Flow, Texture)

Paint film having an uneven texture, much like the skin of an orange.

#### Cause

- (1) The paint is under reduction. The viscosity is too high for spray conditions.
- (2) Thinner/reducer evaporates too fast for spray conditions.
- (3) Extreme shop temperature. When ambient temperature is too high, droplets lose more solvent and dry out before they can flow and level properly.
- (4) Improper gun adjustment and techniques.
  - ① Excessively thick or thin film, spray gun too far from surface.
  - ② Incorrect compressed air pressure and nozzle adjustment.
  - (5) Improper flash-off or recoat time between coats.
  - (6) The substrate was not sanded thoroughly.


#### Prevention

- (1) Reduce to proper viscosity in recommended ratio.
- (2) Select recommended thinner/reducer based on temperature, humidity, air movement, and size of repair.
- (3) Use proper gun adjustments, techniques, and air pressure.
- (4) Ensure sufficient flash-off and drying time.
- (5) Prepare and sand substrate correctly.
- (6) Avoid temperature and humidity extremes. The temperature of the substrate shall be less than 50°C. Recommended air temperature is around 20°C.

#### Repair

- (1) Compound or polish to reduce surface texture.
- (2) Or, sand smooth with very fine grit sandpaper, compound and polish to restore gloss.
- (3) Or, sand down to smooth surface and refinish.

## Runs/Sags

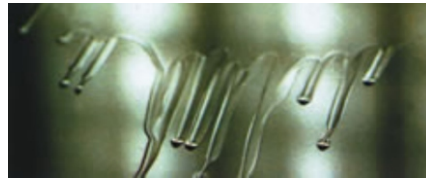

Coatings that fail to adhere uniformly, causing beads, droplets, or slippage of the total film.

#### Cause

- (1) Over reduction and/or too slow evaporating thinner.
- (2) Applying paint materials without proper flash-off time between coats.
- (3) Applying excessive wet coats due to:
  - ① Holding the gun too close to the surface.
  - ② Slow gun speed.
  - ③ Double coating.
- (4) Incorrect gun set-up and too low air pressure.
- (5) Unbalanced spray pattern.
- (6) Ambient or substrate temperature too low, or/and poor ventilation.
- (7) Surface is contaminated by oil, grease, etc. or existing paint film is not sanded.

#### Repair

- (1) Remove the wet paint film with solvent, clean and refinish.
- (2) Or, after finish is completely dry. remove excess paint by block sanding with P1200 or finer grit sandpaper, compound and polish to restore gloss.
- (3) Or, sand to a smooth surface and refinish.

## Blushing



### (Milkiness)

A milky gray cloud appears on the surface of the paint film.

#### Cause

- When spraying during humid conditions, air from the spray gun and solvent evaporation lowers the substrate temperature below the dew point, causing moisture in the air to condense in or on the paint film. The condition is aggravated when
- (1) Too fast drying or poor quality thinner is used;
  - (2) Fanning dry the paint film to speed up solvent release;
  - (3) Inadequate heating and / or air movement.

#### Prevention

- (1) Use good quality and proper thinner for spraying conditions.
- (2) Add the recommended amount of retarder solvent when spraying in humid conditions.
- (3) Use proper gun set-up and techniques.
- (4) Ensure the paint booth is properly ventilated, adequately heated.

#### Repair

- (1) Should blushing occur during application:
  - ① apply heat to the affected area, or
  - ② add retarder solvent and apply additional coats.
- (2) If the finish has dried, minor blushing may be corrected by compounding or polishing.
- (3) Severe cases will require sanding and refinishing.

## Fisheyes



### (Silicone Contamination, Cratering)

Small circular, crater-like openings in the finish.

#### Cause

- (1) Contaminations
  - ① Surfaces contaminated with oil, wax, silicone, grease, etc. Silicones adhere firmly to the paint film and require extra effort for their removal. Even small quantities in sanding dust, rags can cause this type of failure.
  - ② The remains of soap, detergent in surface cleaning.
  - ③ Use of silicone-containing polishes in proximity to the spray area.
  - ④ Contaminated air supply, spray gun, other tools and equipments for application.
- (2) spray in too high air pressure, hold the spray gun too close to the surface.

#### Prevention

- (1) Thoroughly clean the surface with wax and grease remover.
- (2) Avoid using silicone polishes in proximity to the paint shop.
- (3) Install an air filtering system that removes and prevents oil and moisture contamination.
- (4) Regular maintenance of the air supply.
- (5) Ensure that the spray gun and compressed air equipment is properly maintained.

#### Repair

- (1) For mild cases, respray the affected area right after the flash off time with paint added fisheye preventer.
- (2) In severe cases, sand the affected area, clean thoroughly and repaint.



## Pinholes



Depressions as small as pin holes or pores of the leather, appear from the top to the bottom of coatings.

### Cause

Pinholes are mainly caused by solvent or moisture, gathering underneath the top layer, no way to volatilize.

- (1) Excessive paint film thickness and no enough time for drying.
- (2) Air trapped in putty and become pinholes after sanding.
- (3) Bad choice of thinner, such as wrong ratio, bad quality, or incorrect type of dry time.
- (4) Incorrect initial cleaning or other pre-treatment, lead moisture existing and bringing about pinholes in the process of evaporation.
- (5) Unsuitable spray techniques, such as incorrect spray gun adjustment or too short distance to the working substrate.
- (6) Insufficient flash-off time before force drying, sudden heating-up, too fast exterior drying.
- (7) Too high temperature of the repair substrate itself.

### Repair

- (1) Sand through to putty layer, fill pinholes and redo putty works where needed, then sand smooth and continue the repair process.
- (2) Pinholes or scratches in the putty surface after sanding can be filled by a thin coat of polyester putty or pinhole filler. Hold the spreader vertical to the surface so that the spreader may push the putty into the holes and does not pull it out at each stroke.

## Solvent Popping



Small bubbles in the top paint film, some burst.

### Cause


It is often seen that more or less moisture goes into the paint film, even in the best refinishing job. When moisture brings enough pressure to paint film, it will lessen adhesion between coats or adhesion of the whole coating to the substrate. Then small bubbles come out. It is often happens in hot, rainy or humid days.

- (1) Main reason: improper preparation and cleaning of surface. Surface not completely dry after sanding or cleaning with water. Use petrol instead of recommended degreaser to degrease, its content of water soluble or foreign matters remain on the surface.
- (2) No enough time for complete evaporation for solvent due to insufficient flash-off between coats or excessive coating thickness of primer.
- (3) Use too fast evaporating thinner or high viscosity paints.
- (4) Bad quality thinner will make the primer not dry properly. After topcoating, solvent remained in the undercoats evaporates by heat and cause popping.
- (5) Insufficient flash-off time before force dry, sudden heating-up, too fast exterior drying.
- (6) Too high temperature for drying.
- (7) Too high air pressure of spray gun or dry spray method for applying primer.

### Repair

Sand and refinish.

## Loss Of Gloss

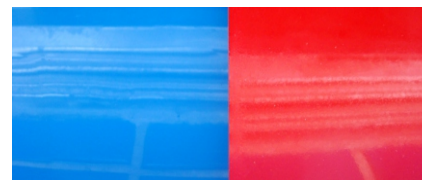

Beautiful shine of wet film but loss of gloss as the film dries or ages.

### Cause

- (1) Coarse substrate and rough sanding paper lead to higher absorption of top coats.
- (2) Excessive thickness and roughness of silver basecoat lead to absorption of clear coat.
- (3) Thick coating of putty which is not thoroughly dry.
- (4) Insufficient dry of the clear coat before polish.
- (5) Improper thinner ratio.
- (6) Thinner choice does not match spray booth condition.
- (7) Bad condition of spray booth may lead moisture trapped onto top coat:
  - ① Insufficient air ventilation or unsuitable air circulation.
  - ② Too hot, too cold or too humid.

### Repair

Polish to improve gloss after paint film dries completely. If ineffective, sand and refinish.

## Lifting / Solvent Aggression



Top coat lifts the undercoat, which causes wrinkling, expanding and bubbling.

### Cause

- (1) Spray top coat before undercoat dries.
- (2) Unsuitable flash-off time between coats.
- (3) Bad solvent resistant of undercoat or too powerful solvency of top coat.
- (4) Bad adhesion of undercoat.
- (5) Excessive thickness of each layer.

### Repair

Lightly sand the affected area and seal the surface, then re-spray; Extra care to the sensitive substrate; Keep each layer thin and flash off time long enough; If lifted seriously, completely remove the entire area and apply the paint system again.

## Poor Adhesion



Bad joint between top coat and primer, or between top coat and existing paint, or between primer and bare metal.

### Cause

- (1) Main reason: Incorrect surface cleaning and preparation. Dust or other contaminations remained on the surface lead to poor adhesion.
- (2) Incompatibility of primer and top coat or incompatibility of primer and substrate.
- (3) Spray top coat before the under coat dries.
- (4) Insufficient sanding or absolutely no sanding makes the substrate too smooth.
- (5) Bad quality thinner and lack of solvency.
- (6) Masking without the first color completely dry during dual-color application.
- (7) While painting silver color, no enough flash-off time between coats or too high viscosity.
- (8) Too long flash-off time between basecoat and clear coat.
- (9) There is invisible water film on the primer surface when spray top coat:
  - ① The weather is too humid while applying primer surface.
  - ② Dry overnight on the primer in humid environment.
- (10) The paint film dry too much before removal of masking may cause peel-off at the edge.

### Repair

- (1) In serious case, remove the existing paint and apply the color system again.
- (2) If caused by the paster, re-sand the affected area and re-spray.

## Poor DIO



Distinctness of Image (DIO) is a value indicates the surface quality of the paint film, which is closely related to the smoothness and gloss of the paint film. Poor DIO means bad decoration performance. DIO can be felt by vision or measured by instrument.


### Cause

- (1) Coarse substrate, rough sanding paper or not fine enough sanding.
- (2) Paint applied runs vertically, lack of gloss, fails in fineness and opacity.
- (3) Bad spray booth condition lead to particles existing on the top and lack of gloss.
- (4) Bad atomization causes serious orange peel.
- (5) Insufficient thickness makes lack of saturation.

### Repair

Compound and polish after the topcoat is completely dry or refinish with another good quality product.

## Cracking

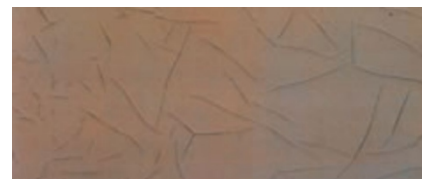

Cracks or lines of various width, length and depth exist in the coating finish.

### Cause

- (1) Existing cracking of the old paint film is not sanded completely before top coat.
- (2) Imperfect aged existing paint which is incompatible to the refinishing system.
- (3) Unsuitable substrate treatment:
  - ① too rough sanding material.
  - ② not clean enough.
  - ③ improper application of body filler.
- (4) Spray thermopaint onto the insufficient hardened paint film or thermoplastic acrylic coat.
- (5) Cracks of putty.
- (6) Excessive thickness: the thicker of the paint (especially air dried type), the lower tolerance to cold and lead to crack.
- (7) The paint is not mixed well with hardener and thinner before spraying, under reduced or reduced with wrong type of thinner.
- (8) Th substrate is too cold or too hot while spraying.

### Repair

- (1) If slight affection, re-sand the affected area and re-spray.
- (2) In serious case, remove the existing paint and apply the color system again.

## Wrinkling



Textured surface of the paint film with uneven wave type formation. This happens when the surface of the paint film dries faster than the substrate coats.


### Cause

- (1) Excessive coat thickness.
- (2) Bad dry condition:
  - ① too low or too high temperature.
  - ② too large or too small air flow.
  - ③ polluted air.
- (3) Insufficient flash-off time, or high temperature accelerated drying, or sun exposure.
- (4) Incorrect thinner: too powerful penetrability of thinner may swell to wrinkle.
- (5) Too long time for some synthetic resin baking finish to dry in the air before baking.
- (6) Sray polyurethane coat onto the existing nitril paint and re-mend later.

### Repair

- (1) Make paint film completely dry.
- (2) If slight affection, re-sand the affected area and polish.
- (3) In serious case, remove the existing paint and apply the color system again.

## Particles and Dust

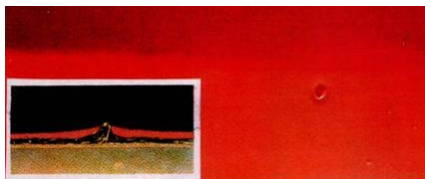

Particles or dirt and dust in the paint surface.

### Cause

- (1) Faulty ceiling filters in the spray booth or baking room.
- (2) Incorrect cleaning of the surface before application of the paint.
- (3) Dirty packing tin and paint not adequately filtered before use.
- (4) Dust in the gaps of the car body not completely blown off.
- (5) Dirty spray booth.
- (6) Incorrect air filtering.
- (7) Dirty application area.
- (8) After spraying, particles in the air drop on the paint surface.
- (9) Paint deterioration.

### Repair

- (1) For very small particles, sand lightly with water and polish.
- (2) If seriously contaminated, sand and then re-spray.

## Poor Drying



The paint film could not dry thoroughly after normal necessary time and requires an extra long drying period, or fails to cure thoroughly.

### Cause

- (1) Incorrect mixing ratio of 2K paint (too much or less of hardener) .
- (2) Unsuitable hardener.
- (3) The temperature could not reach requirement. Normally speaking, when the temperature is lower than 10 °C, the drying process would be excessively slow.
- (4) Over-thickness of the paint film.
- (5) Poor weather condition and poor ventilation.
- (6) Insufficient, bad quality or wrong thinner.
- (7) Incorrect application method.

### Repair

- (1) Increase the drying temperature to make the paint film dry thoroughly.
- (2) If the paint film could not dry thoroughly even by increasing the temperature, sand or remove the paint, then re-spray.

## Clouding or Mottling



Uneven color or poor effect of metallic finishes due to the uneven thickness of sprayed paint and the poor distribution of silver granules.


### Cause

- (1) Insufficient mixing of paint.
- (2) Incorrect thinner or thinner of poor solubility.
- (3) Unsuitable spray viscosity.
- (4) Uneven spray thickness and poor spraying technique.
- (5) Insufficient flash-off time.
- (6) Spray too thick or too wet.
- (7) Incorrect application temperature.

### Repair

- (1) Further spray one coat of paint with correct technique to cover the defects.
- (2) Sand and re-spray when the defected surface is thoroughly dry.

## Sanding marks

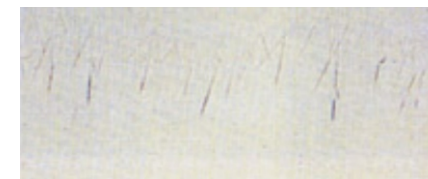

Sanding marks in the substrate show in the topcoat after paint drying.


### Cause

- (1) Incorrect substrate preparation: insufficient filler or poor quality and excessive coarse sanding paper.
- (2) Poor sanding tools or wrong sanding method.
- (3) Insufficient paint thickness of topcoat.
- (4) Sand with no sanding board in flat finishes.
- (5) The primer prior to topcoat is over thick and insufficient drying time for the primer.
- (6) Incorrect preparation of the old existing paint finishes.

### Repair

- (1) Sand with extra fine paper, then polish.
- (2) If the surface is seriously defected, sand, then re-spray.

## Putty Marks or Edge Shrinking

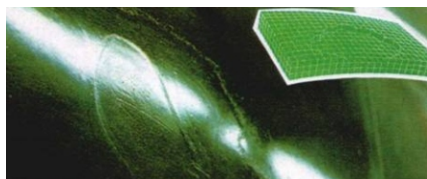

The repaired area by polyester putty or its edge showing in the topcoat.

### Cause

- (1) Insufficient sanding of putty.
- (2) Sanding paper of wrong size.
- (3) Paint absorption of putty is too serious because putty is not sealed by primer surfacer.
- (4) Putty layer too thick and before over-coated, not thoroughly drying.
- (5) Excessive shrinkage of putty; distortion after drying.

### Repair

- (1) Sand the putty layer sufficiently and ensure smooth and even edge of putty.
- (2) Use primer surfacer to seal the repaired area by putty.
- (3) Use putty with small shrinkage.

## Paint Mist, Dry Spray



In the spray process, paint mists drop on the paint finish and make the paint finish rough, full of small particles and loss of gloss.

### Cause

- (1) Incorrect spray method: Spray gun too far away from the surface, not vertical to the surface, spray speed too fast, or air pressure too high.
- (2) Incorrect viscosity; thinner too fast.
- (3) Too near to the surface and easily affected by the paint mist.
- (4) Poor ventilation of the spray booth.
- (5) No covering of the part unnecessary for application.
- (6) Dirty or damaged spray gun.

### Repair

- (1) Primer: Allow it dry, then sand.
- (2) Topcoat: Fine sand the last layer of dry spray, then polish.
- (3) Single layer silver basecoat: Sand and re-spray.

## Color Floating



Because the granule size, shape, density and dispersion of pigments are different, the pigments in the top layer and under layer disperse unevenly, and there is color difference in different spray layer.

### Cause

- Color floating relates closely with pigment convection during the formation process of paint finishes, thus incorrect manufacturing formula and technique are the main reason for this paint defect.
- (1) In the manufacturing which needs more than two pigments, color floating occurs easily because solvent in the coating volatilizes differently.
  - (2) Excessive difference in density of different pigments.
  - (3) Dispersion of color paste could not reach requirement, incorrect dispersion method, or unsuitable dispersing machine.
  - (4) Lack of anti-floating agent.
  - (5) Low viscosity.

### Repair

Re-spray with qualified paint over the defected paint finish.

## Putty Patch or Substrate Scratches



During the paint drying process, paint finish loses gloss and the under layer defects like putty patches and substrate scratches could be seen easily.

### Cause

- (1) Wrong size of sanding paper and poor sanding.
- (2) Substrate dry spray.
- (3) Insufficient flash-off time between layers.
- (4) Poor drying condition.
- (5) Primer is sanded when it is not thoroughly drying.
- (6) Uneven stirring of the primer.
- (7) Poor solubility of thinner.

### Repair

- (1) For small defect, after thoroughly drying, fine sand, then polish.
- (2) In serious cases, after thoroughly drying, fine sand, then re-spray.

## Polyester Putty Adhesion Loss



Adhesion loss between polyester putty and the substrates.


### Cause

- (1) Substrate not properly prepared (main reason).
- (2) Unsuitable polyester putty.
- (3) Improper use of infrared baking machine.

### Repair

Sand the damaged area and redo the repair. (Before application of the putty, better to clean the existing paint finishes with thinner, if the existing paint color fades, sand the existing paint finishes to ensure good substrate).

## Uneven Color, Color Variation

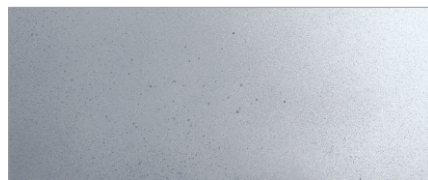

Uneven color in part of the paint finish with streaks or patches of lighter or darker tint.


### Cause

- (1) Poor dispersion of paint pigments; insufficient mixing of different color paint; use thinner with poor solubility; improper viscosity.
- (2) Uneven spray thickness. In thickly sprayed parts, pigments convect and make color floating.
- (3) Poor spraying technique: improper overlapping, too near from the paint surface, wrong angle between the spray gun and the surface (main reason).
- (4) In the application site, there is gas source able to react with paint finish, such as ammonia, or carbon dioxide.
- (5) Spray tools not clean enough.
- (6) Incorrect spray nozzle and spray pressure.
- (7) Unsuitable thinner.

### Repair

Allow the paint finish dry thoroughly, sand wet, then re-spray.

## Off color, Color Mismatching

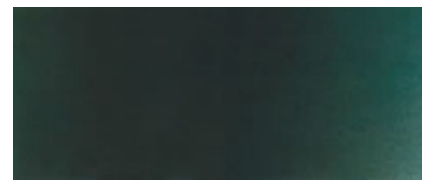

The new sprayed color of the repaired parts is different from the original color of the car being repainted.


### Cause

- (1) Poor color mixing technique or poor spray of spot repair.
- (2) Incorrect application technique, too wet, too dry or poor coverage.
- (3) Color of the mixed paint is different from the color swatch.
- (4) Finish color changes under different light.
- (5) Wrong color formula.
- (6) Insufficient stirring of color tinter.
- (7) Insufficient mixing with hardener or thinner.

### Repair

- (1) For small color mismatch, polish the paint finish.
- (2) In serious cases, fine sand and re-spray with right formula.

## Yellowing of Clear Coat

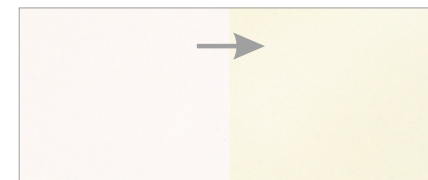

Clear coat has a yellow hue to it.

### Cause

New paint:

- (1) Contaminated mixing equipment.
- (2) Defective clear coat or /and hardener.

Old paint:

- (1) Clear coat too thin.
- (2) Contaminated hardener, no cross link.
- (3) Defective clear coat.
- (4) Influence of corrosive conditions.

### Prevention

- (1) Ensure lids are tightly replaced after using hardeners.
- (2) Follow recommendations per Technical Data Sheets.
- (3) Use recommended hardener.

### Repair

Allow the finish properly dry. Sand and repaint.



## Transparency, Poor Hiding



The under coat or existing finish is visible through the topcoat.

### Cause

- (1) Insufficient number or/and film thickness of color coat applied.
- (2) Colors not well stirred.
- (3) Colors over thinned.
- (4) Topcoat over compounded or polished.
- (5) Substrate's color was not correct and uniform.
- (6) Inadequate lighting in spray area.

### Prevention

- (1) Use thinner according to recommended ratio.
- (2) Stir color thoroughly.
- (3) Use proper undercoat.
- (4) Install adequate lighting device.
- (5) Compound or polish in appropriate technique.

### Repair

Apply sufficient coats of color until hiding is achieved. Or sand and repaint.

## Bleeding



Existing finish color or peroxide hardener from polyester body filler seeping through the topcoat, causing a discoloration of the new finish.

### Cause

- (1) Solvent in the new topcoat dissolves soluble dyes or pigments in the existing finish. This is usually true with older shades of red or maroon.
- (2) Apply top coat on undercoat not thoroughly dry.
- (3) Existing finish not well sealed.
- (4) Use of too much hardener in the polyester putty or filler.
- (5) Insufficient mixing of the polyester putty or filler.

### Prevention

- (1) Test existing finish by spraying a small area.
- (2) Use sealer on existing finish.
- (3) Mix polyester putty with recommended hardener by weight and mix thoroughly.
- (4) Ensure the undercoat is properly dry.

### Repair

Sand down to existing finish, isolated with proper sealer and repaint.

## Chalking



A chalky white appearance on the surface of the paint film.

### Cause

- (1) Pigment is no longer held and protected by resin, resulting in a powder-like surface and lack of gloss due to
  - ① Nature weathering of the paint film;
  - ② Use improper thinner, or/and hardener;
  - ③ Inadequate paint film thickness;
  - ④ Repeat exposure to harsh environment or strong sunlight.

### Prevention

- (1) Use recommended thinner/hardener.
- (2) Avoid exposure to strong sunlight and harsh environment.

### Repair

Compound and polish to restore gloss. In severe cases, sand and repaint topcoat.

## Fading



Color pigments changed after exposure to prolonged sunlight.

### Cause

- (1) Inferior paint used for refinishing.
- (2) Repeated exposure to strong sunlight or corrosive atmosphere or contaminations .
- (3) Use inappropriate hardener which lower the properties of the paint film.

### Prevention

- (1) Use quality paint for refinishing.
- (2) Protect the vehicle from bright sunlight when not in use.
- (3) Keep vehicle clean and well maintained.
- (4) Use recommended hardener per Technical Data Sheet.

### Repair

Sand and repaint.